



For: • RTA Inspector's Vehicle Regulation • Engineering Signatories • RTA Registry Service Managers  
• HVAIS Proprietors & Examiners

## Safety Recall Campaign

### Argosy Brake Pedal Assembly on *Freightliner* Vehicles

---

#### Introduction

DaimlerChrysler Australia/Pacific Limited has announced a Safety Recall Campaign for 264 *Freightliner* vehicles.

DaimlerChrysler has determined that the brake pedal pivot and roller pin retaining clip may not have been correctly installed, which could result in the pins becoming dislodged and thereby resulting in an inability to apply the service brake using the brake pedal.

Should any of these vehicles be presented for inspection, Inspectors are to ascertain whether or not the vehicle has been checked by a DaimlerChrysler dealer in accordance with the attached Service Bulletin. Vehicles which have been checked will be identified with a completion sticker on the "A" pillar referencing the recall campaign number T271/99/A.

#### Enforcement

- **RTA Inspectors**

If the vehicle inspected has a VIN identical to the attached list, but is not fitted with a completion sticker T271/99/A:

Issue a major defect notice and attach a yellow defective vehicle label allowing sufficient time to travel to the nearest approved/authorised agent.

If there are any visible signs of separation/cracking issue a major-ground defect notice and attach a red defective vehicle label and advise the operator the vehicle may only be towed/lifted away.

- **HVAIS Examiners**

If the vehicle inspected has a VIN identical to the attached list, but is not fitted with a completion sticker T271/99/A:

Reject the vehicle and issue a white inspection report in the normal manner.

If there are any visible signs of separation/ cracking nominate a dangerous defect and advise the operator the vehicle may only be towed/lifted away.

**Note:**

If you are uncertain whether a vehicle is associated with this recall campaign, please contact technical enquiries.

---

**Further Information** - RTA Technical Enquiries:

Tel: 1300 137 302  
Fax: (02) 9843 3821  
Email: tech-enq@rta.nsw.gov.au

Postal Address: RTA Technical Enquiries  
P O Box 1120  
PARRAMATTA NSW 2124

**Attachment to Vehicle Inspector's Bulletin No. 47  
issued by Roads & Traffic Authority NSW, November 2001**

**Ref: DaimlerChrysler Aust. Recall T271/99/A on Argosy Brake Pedal  
Assemblies fitted to some *Freightliner* vehicles**



***service bulletin***

---

**FREIGHTLINER:**

**DECEMBER 2000**

**GROUP 42 - 17**

**DISTRIBUTION:**

**All Service, Sales, Spare Parts and Warranty  
Personnel  
Regional Service Personnel  
Freightliner Dealers**

**SUBJECT: Recall T271/99/A Argosy Brake Pedal Assembly**

**INTRODUCTION:**

DaimlerChrysler Australia/Pacific, on behalf of Freightliner Truck Division, has determined that a defect, which relates to motor vehicle safety, may exist on the vehicles mentioned above. There are 264 vehicles involved in this campaign (refer to attached chassis list).

The brake pedal pivot and roller pin retaining clips may not have been correctly installed. If this occurred, the pins might become dislodged, thereby resulting in an inability to apply the service brakes using the brake pedal. This could result in an accident without prior warning.

The modification consists of removing and replacing the brake pedal pivot and roller pin with a longer pin that will prevent mis-installation of the retaining clips.

**WORKING INSTRUCTIONS:**

Please refer to the attached work instructions.

**REPLACEMENT PARTS:**

Replacement parts are now available and can be obtained by ordering the kit number listed below from your Parts Distribution Center.

Part Number	Description	Qty Per Veh
FLC 25-FL247-000	Argosy brake pedal roller kit	1

**REMOVED PARTS**

As the parts removed are part of a recall please destroy and scrap all removed parts. By filing a claim, you are certifying that you have destroyed all removed parts.

**WARRANTY:**

SRT Code	Damage Code	Text	Time
996-0329A	000-modifiedx	Remove/replace brake pedal pivot and roller pins.	0.4 hrs

**IMPORTANT:** When the recall has been completed, clean a spot on the drivers side "A" pillar of the vehicle and attach a completion sticker (Form W-147) referencing the Recall Campaign number T271/99/A and date the work was performed.



**R.D.POWER**  
Senior Manager  
Commercial Vehicle Service

# WORK INSTRUCTIONS

## Argosy Brake Pedal Assembly

**MODELS AFFECTED:** Freightliner specific Argosy vehicles manufactured prior to June 16, 2000

### Brake Pedal Pivot and Roller Pin Replacement

1. Before starting this procedure, check the driver's side "A" pillar for a completion label (Form W-147). If a label for T271/99/A is found, no further work is required.
2. Park the vehicle on a level surface, shut down the engine, and apply the park brake.
3. Remove the retaining clip from the pivot pin. Remove the pivot pin from the brake pedal assembly, and remove the brake pedal. See **Fig. 1**. Discard the old retaining clip and pivot pin.
4. Remove the retaining clip from the roller pin. See **Fig. 2**. Remove the roller pin and rollers from the pedal assembly. See **Fig. 3** and **Fig. 4**. Discard the old retaining clip and roller pin, but save the rollers so they can be reused.
5. Apply grease to the new roller pin. Install the old rollers, new roller pin, and new retaining clip. See **Fig. 3** and **Fig. 4**.
6. Apply grease to the new pivot pin. Install the brake pedal, new pivot pin and new retaining clip. See **Fig. 1**.
7. Record the recall number T271/99/A and the date the work is performed on a completion label (Form W-147). Clean an area on the driver side "A" pillar and attach the label.

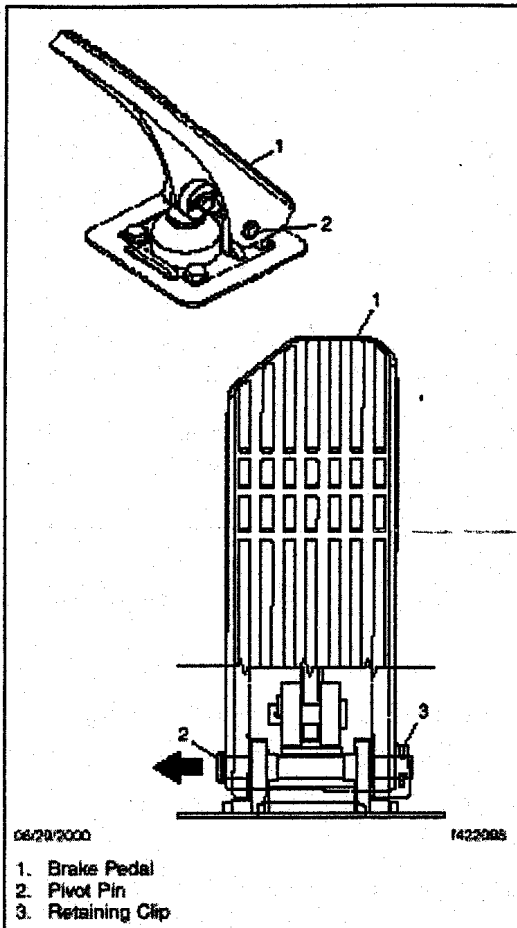


Fig. 1. Brake Pedal

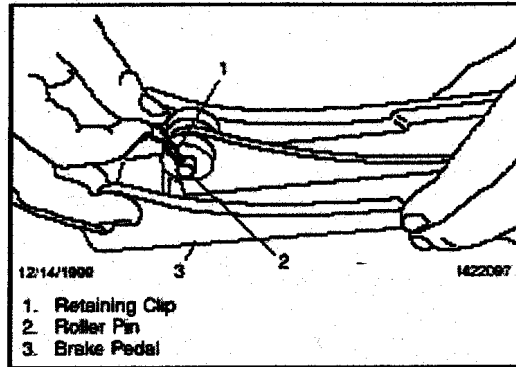


Fig. 2. Remove the Retaining Clip

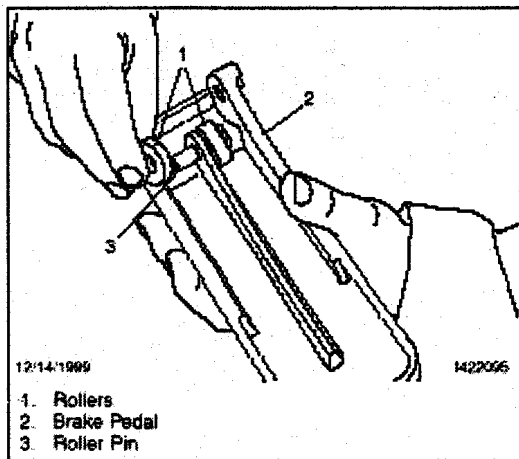


Fig. 3. Roller Pin Replacement

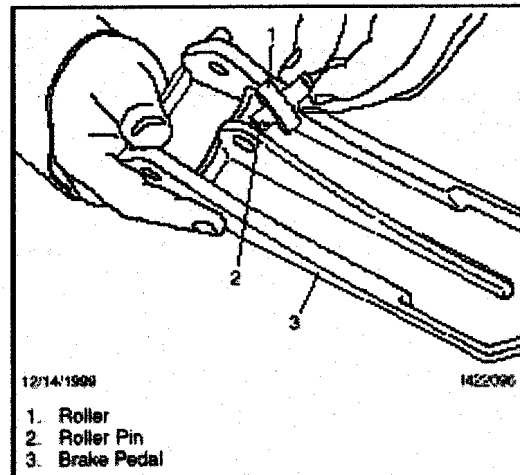


Fig. 4. Roller Pin Replacement

# DaimlerChrysler Aust. Recall T271/99/A

## List of Vehicle Identification Numbers of affected vehicles

VIN	Chassis	VIN	Chassis	VIN	Chassis	VIN	Chassis
1FVYL7WB2XL938896	938896	1FVJAWAYX1L958768	958768	1FVYL7WB4XL938897	938897	1FVJAWAV91L993372	993372
1FVYLSZBXXL938837	938897	1FVJAWAY11L958769	958769	1FVYL7WB6XL938903	938903	1FVJAWAV01L993373	993373
1FVYL7WB4XL938902	938902	1FVJAWAY81L958770	958770	1FVYL7WB5XL938908	938908	1FVYLXZB8XL938736	938736
1FVJAWBG41L938912	938912	1FVJAWAYX1L958771	958771	1FVYL7WBX1L938913	938913	1FVYLSZB8XL938934	938934
1FVJAWBG81L938914	938914	1FVYLXZB51L958806	958806	1FVYLSZB9XL938926	938926	1FVYLSZBXXL938935	938935
1FVJAWBGX1L938915	938915	1FVYL7WB61L958866	958866	1FVYLSZB4XL938932	938932	1FVYLXYB6XL938946	938946
1FVJAWBG11L938916	938916	1FVJAWAV81L958869	958869	1FVYLSZB6XL938933	938933	1FVJAWAV01L938955	938955
1FVJAWBG31L938917	938917	1FVJAWAY31L958871	958871	1FVYLSZB3XL938940	938940	1FVJAWAV21L938956	938956
1FVJAWBG71L938919	938919	1FVJAWAV01L958896	958896	1FVYLSZB5XL938941	938941	1FVYLXYBXXL958228	958228
1FVYL7WB91L938921	938921	1FVJAWAV11L958900	958900	1FVYL2WB51L938966	938966	1FVYL7WB6XL938884	938884
1FVYL7WB21L938923	938923	1FVJAWAV11L958910	958910	1FVYL2WB01L938969	938969	1FVYL2WB81L938900	938900
1FVYL7WB61L938925	938925	1FVJAWCK31L959026	959026	1FVYLXYB2XL958241	958241	1FVYL7WB01L938922	938922
1FVYL2WB91L938954	938954	1FVJAWAY61L959125	959125	1FVYL7WB91L958778	958778	1FVYLSZB2XL938931	938931
1FVJAWBG41L938957	938957	1FVJAWCK31L959169	959169	1FVYL7WB01L958779	958779	1FVYLXYB21L958246	958246
1FVJAWBG61L938958	938958	1FVJAWBG51L959171	959171	1FVYL7WB01L958843	958843	1FVYL2WB81L958807	958807
1FVYL7WBX1L938961	938961	1FVJAWAVX1L993350	993350	1FVJAWAV11L958844	958844	1FVYL2WBX1L958808	958808
1FVYL7WB11L938962	938962	1FVJAWAV11L993351	993351	1FVJAWAV51L958845	958845	1FVYLXZB1XL958827	958827
1FVYL7WB31L938963	938963	1FVJAWAV31L993352	993352	1FVYL7WB0XL958855	958855	1FVJAWAV31L958875	958875
1FVYL7WB71L938965	938965	1FVJAWAV51L993353	993353	1FVYL7WB0XL958872	958872	1FJAWACK11L958893	958893
1FVYLXYB11L938974	938974	1FVJAWAV71L993354	993354	1FJAWACK81L958874	958874	1FJAWACK31L958894	958894
1FVYLXYB3XL958233	958233	1FVJAWAV91L993355	993355	1FVYLXYB0XL958903	958903	1FJAWACK11L958909	958909
1FVYLXYB0XL958237	958237	1FVJAWAV01L993356	993356	1FVYL7WB6XL938867	938867	1FVYLSZB41L958962	958962
1FVYLXYB2XL958238	958238	1FVJAWAV21L993357	993357	1FVYL7WB2XL938879	938879	1FVYLSZB01L958957	958957
1FVYLXZB8XL958243	958243	1FVJAWCK21L993359	993359	1FVYL7WB7XL938909	938909	1FVYLSZB21L958958	958958
1FVYLXYBXXL958245	958245	1FVJAWCK91L993360	993360	1FVYLSZB3XL938937	938937	1FVYLSZB41L958959	958959
1FVJAWAV01L958249	958249	1FVJAWCK01L993361	993361	1FVYLXYB2XL938944	938944	1FVYLSZB01L958960	958960
1FVYLXZB21L958763	958763	1FVJAWCK21L993362	993362	1FVYL2WB81L938959	938959	1FVYLSZB21L958961	958961
1FVYLXZB41L958764	958764	1FVJAWCK41L993363	993363	1FVYLXYB5XL958234	958234	1FVHAWCG41L959126	959126
1FVYLXZB61L958765	958765	1FVJAWAY71L993364	993364	1FVYLXYB7XL958235	958235	1FVYLSZB6XL938737	938737
1FVYLXZB81L958766	958766	1FVJAWAY91L993365	993365	1FVYLXYBXL958236	958236	1FVYL7WB6XL938870	938870
1FVYLXZBX1L958767	958767	1FVJAWAY01L993366	993366	1FVYLXYB11L958240	958240	1FVYL7WB8XL938871	938871
		1FVJAWAY21L993367	993367	1FVYLXYB51L958242	958242	1FVYL7WBXXL938872	938872
		1FVJAWCK31L993368	993368	1FVYLXYB41L958250	958250	1FVYL7WB4XL938883	938883
		1FVJAWCK51L993369	993369	1FVYLXYB61L958251	958251	1FVYL7WB1XL938887	938887
		1FVJAWCK11L993370	993370	1FVYLXZB01L958762	958762	1FVYL7WB3XL938891	938891
		1FVJAWAY41L993371	993371	1FVYLXYB81L958803	958803	1FVYL7WB7XL938893	938893

# DaimlerChrysler Aust. Recall T271/99/A

## List of Vehicle Identification Numbers of affected vehicles (cont'd)

VIN	Chassis	VIN	Chassis	VIN	Chassis	VIN	Chassis
1FVYLXZB11L958804	958804	1FVYLXB0XL938943	938943	1FVYL7WBXXL938886	938886	1FVYL2WB4XL958876	958876
1FVJAWCK11L958828	958828	1FVYLXYB81L938972	938972	1FVYL7WB1XL938890	938890	1FVYLXYB3XL958877	958877
1FVYLXYB5XL958833	958833	1FVYLXYB4XL958225	958225	1FVJAWBG61L958899	958899	1FVYL7WB8XL938885	938885
1FVYLXYB9XL958835	958835	1FVYLXYB6XL958226	958226	1FVYLXYB9XL958902	958902	1FVYL7WB2XL938901	938901
1FVJAWAV61L958837	958837	1FVYLXYB8XL958227	958227	1FVJAWAV51L938918	938918	1FVYL7WB11L958791	958791
1FVJAWAVX1L958839	958839	1FVYLXYB8XL958230	958230	1FVYLXYB91L958907	958907	1FVYL7WB31L958792	958792
1FVJAWAVX1L958842	958842	1FVYLXYBXXL958231	958231	1FVJAWCK41L959083	959083	1FVYL7WB0XL938881	938881
1FVJAWAV71L958846	958846	1FVJAWAY61L958248	958248	1FVYLXYB1XL958229	958229	1FVYL7WB0XL938895	938895
1FUYLWEB3XL958851	958851	1FVYL7WB31L958775	958775	1FVYLXYB1XL958232	958232	1FVYL7WBXXL938905	938905
1FUYLWEB5XL958852	958852	1FVYLXYB0XL958805	958805	1FVYL7WB5XL938892	938892	1FVYL7WB41L938907	938907
1FUYLWEB7XL958853	958853	1FVYLXYBXXL958830	958830	1FVYLSZB8XL938951	938951	1FVYLSZB0XL938927	938927
1FUYLWEB9XL958854	958854	1FVYLXYB1XL958831	958831	1FVYLSZB1XL938953	938953	1FVYL7WB3XL938938	938938
1FVJAWAV41L958870	958870	1FVYLXYB3XL958832	958832	1FVYL2WB71L938970	938970	1FVYL7WB5XL938939	938939
1FVJAWCK61L958873	958873	1FVYLXYB7XL958834	958834	1FVYL2WB91L938971	938971	1FVYL2WB1XL938942	938942
1FVJAWAV91L958895	958895	1FVJAWAV41L958836	958836	1FVJAWCK21L959082	959082	1FVYLXYB41L958247	958247
1FVJAWCK01L958898	958898	1FVJAWAV81L958838	958838	1FVJAWCK81L959085	959085	1FVYLXYB51L958824	958824
1FVJAWAS71L959128	959128	1FVJAWAV91L958847	958847	1FVYL7WB3XL938874	938874	1FVYLXYB71L958825	958825
1FVJAWAS91L959129	959129	1FVYLXYB9XL958897	958897	1FVYLSZB1XL938936	938936	1FVYL7WB1XL938873	938873
1FVJAWAS51L959130	959130	1FVJAWAV21L959127	959127	1FVYLXYB8XL938950	938950	1FVYL7WB7XL938876	938876
1FVJAWAS71L959131	959131	1FVYL7WB3XL938888	938888	1FVYL2WB71L938967	938967	1FVYL7WB9XL938894	938894
1FVJAWAS91L959132	959132	1FVJAWAV31L958908	958908	1FVYL2WB91L938968	938968	1FVYL7WB8XL938904	938904
1FVJAWAS01L959133	959133	1FVYL7WB5XL938875	938875	1FVYLXYB8XL958244	958244	1FVYL7WB71L938920	938920
1FVJAWAVX1L959134	959134	1FVYL7WB0XL938878	938878	1FVJAWAV81L958841	958841	1FVJAWCKX1L959170	959170
1FVJAWAV11L959135	959135	1FVYL7WB41L938910	938910	1FVJAWCK61L959084	959084	1FVYLXYBX1L938973	938973
1FVJAWAV31L959136	959136	1FVYL7WB41L938924	938924	1FVJAWCK01L993358	993358	1FVJAWBG01L958901	958901
1FVJAWAV51L959137	959137	1FVJAWAV41L959145	959145	1FVYL7WB9XL938877	938877	1FVYL7WB9XL938880	938880
1FVJAWAV71L959138	959138	1FVYL7WB2XL938882	938882	1FVYL7WB6XL938898	938898	1FVJAWAV41L958867	958867
1FVJAWAV91L959139	959139	1FVYLSZB0XL938930	938930	1FVYL7WB21L938906	938906		
1FVJAWAV51L959140	959140	1FVYLXYB4XL938945	938945	1FVYLXYB8XL938947	938947		
1FVJAWAV71L959141	959141	1FVYLXYBXXL938948	938948	1FVYL7WB81L938960	938960		
1FVJAWAV91L959142	959142	1FVYLXYB1XL938949	938949	1FVYL7WB51L958776	958776		
1FVJAWAV01L959143	959143	1FVYLSZBXXL938952	938952	1FVYL7WB71L958777	958777		
1FVYLSZB8XL938836	938836	1FVYL7WB51L938964	938964	1FVJAWAV61L958840	958840		
1FVYL7WB5XL938889	938889	1FVYLXYB91L958826	958826	1FVYLSZB2XL938928	938928		
1FVYL7WB8XL938899	938899	1FVYL7WB8XL938868	938868	1FVYLSZB4XL938929	938929		
1FVYLXYBX1L938911	938911	1FVYL7WBXXL938869	938869	1FVYLXYB4XL958239	958239		